

ANGLIA Range

(EXPORT)

26th March, 1964

Last Service Letter issued for "Anglia" Range—No. 25—see Section: "Bodywork, Mudguards—Bonnet".

HEATER PLENUM CHAMBER DRAIN TUBES




New "Anglia" Range

The metal plenum drain tubes and rubber elbow connections have been replaced by plastic drain tubes. The metal tubes will no longer be available in service once present stocks are exhausted.

Details of parts numbers are given below:—

Metal drain tube and integral clip ..	E542-T-1	Obsolete
Rubber elbow connection	E545-T-1	Obsolete
Plastic tube	105E-18B564	Current production
Securing clip	105E-18K272	Current production

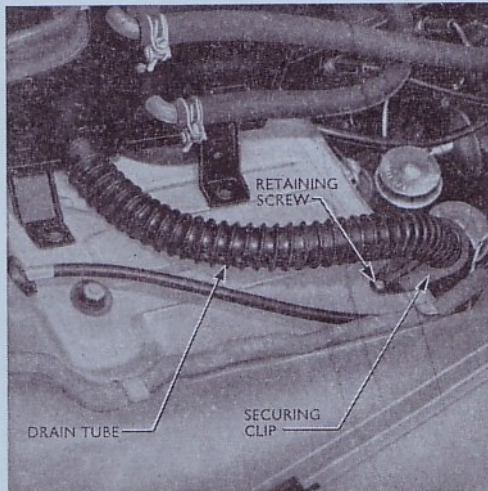

If, for any reason, it is necessary to replace the metal tubes with the plastic ones, the holes for securing the clips to the windshield opening panel must be resited. The position of these holes is not critical but it is advisable to temporarily fit the pipe in position, refer to the accompanying illustration, and mark where the holes should be, using the clips as templates. The holes can be drilled (0.125 in. dia.), and the tubes can then be fitted and secured in position with a self-tapping screw through each clip.

The foregoing is for Dealer Information Only. Without exception all gratis repairs and replacements are subject to the current Warranty and Policy procedure.

No 33

PASSENGER CAR SERVICE LETTER 1964 series

ISSUED BY TECHNICAL PUBLICATIONS, Parts Sales and Service Operations

Ford Motor Company, Ltd. DAGENHAM, ESSEX.